



Applies To: **2008–09 Accord** – ALL with M/T
2006–10 Civic – ALL with M/T
2006–10 Element – ALL with M/T

July 12, 2011

Clutch Pedal Pops, Squeaks, or Clicks

(Supersedes 11-005, dated March 31, 2011, to revise the information marked by the black bars)

REVISION SUMMARY

Under PARTS INFORMATION, the Accord and Civic part number was updated.

SYMPTOM

The clutch pedal pops, squeaks, or clicks when you press or release it.

PROBABLE CAUSE

The clutch master cylinder has insufficient clearance between the piston and the push rod.

CORRECTIVE ACTION

Replace the clutch master cylinder.

PARTS INFORMATION

Clutch Master Cylinder Assembly:

Accord and Civic: P/N 46925-TA0-A02
(Includes clutch master cylinder, O-ring, and seal)

Element: P/N 46920-S7A-A04
(Includes clutch master cylinder, O-ring, seal, and snap pin)

Snap Pin:

Accord and Civic: P/N 46942-S5A-003

REQUIRED MATERIALS

Honda Genuine DOT 3 Brake Fluid: P/N 08798-9008
(Each repair requires one bottle.)

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number: 211101

Flat Rate Time:

Accord: 0.9 hour

Civic: 1.2 hours

Element: 0.8 hour

Failed Part: P/N 46920-SNA-A02

Defect Code: 03214

Symptom Code: 04201

Skill Level: Repair Technician

REPAIR PROCEDURE

Replace the clutch master cylinder:

- Refer to the appropriate service manual, or
- Online, enter keywords **MASTER CYLINDER**, and select **Clutch Master Cylinder Replacement** (for the appropriate engine) from the list.